 
 


Date: Thursday, 11/16/2006 4:21:59 PM
 User: Kim Johnston

Process Sheet

Customer : CU-DAR001 Dart Helicopters Services Drawing Name : SKID TUBE ASSEMBLY
 Job Number : 29470
 Estimate Number : 10023
 P.O. Number : N/A Part Number : D205634041
 This Issue : 11/16/2006 S.O. No. : N/A Drawing Number : D2580 REV.C
 Prsht Rev. : NC Project Number : N/A
 First Issue : N/A Type : LANDING GEAR Drawing Revision : C
 Previous Run : 29465 Material : N/A
 Due Date : 12/10/2006 Qty: 1 Um: Each
 Written By : 
 Checked & Approved By : 
 Comment : Est Rev: N 02/08.28 FP was QC5 in Step 27; Added QC5 to Step 30 KJ
 Est Rev. O 06.02.28 Added paperwork EC

Additional Product

Job Number:



| Seq. #: | Machine Or Operation: | Description : |
|---------|-----------------------|------------------|
| 1.0 | DC | DOCUMENT CONTROL |

1.0

DC

DOCUMENT CONTROL



Comment: DOCUMENT CONTROL

Photocopy D205-634 bluefile & type labels per PPP D205-634 CHG001

KS 26.11.20

2.0

D25001190

Ext'n -1" Beam Tube 4"



Comment: Qty.: 1.0400 Each(s)/Unit Total : 1.0400 Each(s)

Pick:

Qty Part Number

Description

Batch

1 D2500-1-190

Skid Tube Extrusion

B25858

m.R 06/11/27 ①

3.0

D2596

205 Web



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

1 D2596

205 Web

B29722

m.R 06/11/29 ①

4.0

LANDING GEAR 1

LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1- Inspect mat'l D2500-1-190 for damage

2-Cut D2500-1-190 per Dwg D2580 if necessary Deburr ends

3-Drill pilot holes using drill jig DT 8149

4-Acid etch and Alodine tube per QSI 005 4.1

m.R 06/11/28

m.R 06/11/28

m.R 06/11/28

m.R 06/11/27 ①

| W/O: | | WORK ORDER CHANGES | | | | | | |
|------|------|--------------------|--|----|------|-----|-------------------------------------|--------------------------|
| DATE | STEP | PROCEDURE CHANGE | | By | Date | Qty | Approval Chief Eng / Prod Mgr | Approval QC Inspector |
| | | | | | | | | |
| | | | | | | | | |

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

| NCR: | | WORK ORDER NON-CONFORMANCE (NCR) | | | | | | |
|------|------|----------------------------------|--------------------------------|---------------------------------|----------------|---------------------------|-----------------------|--------------------------|
| DATE | STEP | Description of NC Section A | Corrective Action Section B | | | Verification Section C | Approval Chief Eng | Approval QC Inspector |
| | | | Initial Chief Eng | Action Description Chief Eng | Sign & Date | | | |
| | | | | | | | | |
| | | | | | | | | |
| | | | | | | | | |

NOTE: Date & initial all entries

Date: Thursday, 11/16/2006 4:22:00 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: SKID TUBE ASSEMBLY

Job Number: 29470

Part Number: D205634041

Job Number:



Seq. #:

Machine Or Operation:

Description:

5-Open holes to 0.500" as per Dwg D2580 without cutting fluid

JD/pw 06/11/29

6-Countersink holes as per Dwg D2580 without cutting fluid

JD/pw 06/11/29

7-Deburr and blow out all chips from inside of tube

JD/pw 06/11/29

8-Bond web in place per QSI 015. Allow 12 Hrs. cure time before cutting

Pick:

Qty Part Number Description Batch

A/R Sikaflex-291 M102660

Sikaflex expire date: 07-02-01

Start Time: 12:42pm Date: 06/11/29

Fin Time: 8:15AM Date: 06-12-4

pw m-h 06/11/29 ①

5.0

BENDING

BENDING MACHINE



Comment: BENDING MACHINE

1-Bend as per program D2580.C on CNC Bender and Folio FT009

2-Cut tubes as per Dwg. D2580

DPG-12-4

6.0

LANDING GEAR 1

LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Deburr ends after cutting. Remove alodine from around holes

pw m-h 06/12/05 ①

7.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

06/12/05 ①

8.0

D25763

Step (Machining Detail)



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Pick:

Qty Part Number Description Batch

1 D2576-3 Step 23060

BE 06-12-06

| W/O: | | WORK ORDER CHANGES | | | | | | |
|------|------|--------------------|--|----|------|-----|-------------------------------------|--------------------------|
| DATE | STEP | PROCEDURE CHANGE | | By | Date | Qty | Approval Chief Eng / Prod Mgr | Approval QC Inspector |
| | | | | | | | | |
| | | | | | | | | |

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

| NCR: | | WORK ORDER NON-CONFORMANCE (NCR) | | | | | | |
|------|------|----------------------------------|--------------------------------|---------------------------------|----------------|---------------------------|-----------------------|--------------------------|
| DATE | STEP | Description of NC Section A | Corrective Action Section B | | | Verification Section C | Approval Chief Eng | Approval QC Inspector |
| | | | Initial Chief Eng | Action Description Chief Eng | Sign & Date | | | |
| | | | | | | | | |
| | | | | | | | | |
| | | | | | | | | |

NOTE: Date & initial all entries

Date: Thursday, 11/16/2006 4:22:00 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: SKID TUBE ASSEMBLY

Job Number: 29470

Part Number: D205634041

Job Number:



Seq. #:

Machine Or Operation:

Description:

9.0

D2579

Crossbolt Spacer



Comment: Qty.: 20.0000 Each(s)/Unit Total: 20.0000 Each(s)

Pick:

Qty Part Number Description Batch

20

D2579

Spacers

B 29489

BE 06-12-06

10.0

LARGE FAB 1

LARGE FABRICATION RESOURCE 1



Comment: LARGE FABRICATION RESOURCE 1

1-Prepare tube for welding D2576-3 StepRemove alodine as required.

BE 06-12-06

2-Weld step D2576 as per Dwg. D2580 and QSI 004

A/R

Aluminum Rod

m101446

BE 06-12-06

3-Weld crossbolt spacers D2579 as per Dwg. D2580 and QSI 004. For D2579

spacers, weld one

side, pass 3/8" drill, weld other side, pass 3/8" drill

A/R

Aluminum Rod

m101446

BE 06-12-06

4-Grind welds as per Dwg D2580 Grind flush ridge made from bending

JD/pm 06-12-70

5-Drill holes for wearplates using DT 8217Open holes to 19/64", adjust stopper not to hit web. Deburr

pm 06-12-70

6-Counterbore crossbolt spacers to 7/16" ID x 1.0" deep as per Dwg D2580. Deburr holes

pm 06-12-70

7-Drill pilot holes for aft cap using DT 8215Open holes to #6 Drill bit. Deburr

pm 06-12-70

8-Drill pilot holes for Tow ring using DT8091, open to .640"and Deburr

pm 06-12-70

11.0

QC9

VISUAL WELDING INSPECTION



Comment: VISUAL WELDING INSPECTION

11/06/12/11 0

12.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

11/06/12/11 1

| W/O: | | WORK ORDER CHANGES | | | | | | |
|------|------|--------------------|--|----|------|-----|-------------------------------------|--------------------------|
| DATE | STEP | PROCEDURE CHANGE | | By | Date | Qty | Approval Chief Eng / Prod Mgr | Approval QC Inspector |
| | | | | | | | | |
| | | | | | | | | |

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

| NCR: | | WORK ORDER NON-CONFORMANCE (NCR) | | | | | | |
|------|------|----------------------------------|--------------------------------|---------------------------------|----------------|---------------------------|-----------------------|--------------------------|
| DATE | STEP | Description of NC Section A | Corrective Action Section B | | | Verification Section C | Approval Chief Eng | Approval QC Inspector |
| | | | Initial Chief Eng | Action Description Chief Eng | Sign & Date | | | |
| | | | | | | | | |
| | | | | | | | | |
| | | | | | | | | |

NOTE: Date & initial all entries

Date: Thursday, 11/16/2006 4:22:00 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: SKID TUBE ASSEMBLY

Job Number: 29470

Part Number: D205634041

Job Number:



Seq. #:

Machine Or Operation:

Description :

13.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



M102341



Comment: HAND FINISHING RESOURCE #1

Powder Coat White (Ref: 4.3.5.2) as per QSI 005 4.3

m.l/a.m

06/12/14

14.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

40

06/12/14 x

15.0

D25771

Wearplate Fwd



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

| Qty | Part Number | Description | Batch |
|-----|-------------|-------------|--------|
| 1 | D2577-1 | Wearplate | B28003 |

16.0

D25773

Wearplate Aft



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

| Qty | Part Number | Description | Batch |
|-----|-------------|-------------|--------|
| 1 | D2577-3 | Wearplate | B28013 |

17.0

D25775

Wearplate, Centre



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

| Qty | Part Number | Description | Batch |
|-----|-------------|-------------|--------|
| 1 | D2577-5 | Wearplate | B28122 |

18.0

ALS71032130

Insert



Comment: Qty.: 44.0000 Each(s)/Unit Total : 44.0000 Each(s)

Pick:

| Qty | Part Number | Description | Batch |
|-----|-----------------------|-------------|--------|
| 44 | ALS7-1032-130 ALS4 | Inserts | M18964 |

a.m 06/12/14 (1)

| W/O: | | WORK ORDER CHANGES | | | | | | |
|------|------|--------------------|--|----|------|-----|-------------------------------------|--------------------------|
| DATE | STEP | PROCEDURE CHANGE | | By | Date | Qty | Approval Chief Eng / Prod Mgr | Approval QC Inspector |
| | | | | | | | | |
| | | | | | | | | |

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

| NCR: | | WORK ORDER NON-CONFORMANCE (NCR) | | | | | | |
|------|------|----------------------------------|--------------------------------|---------------------------------|----------------|---------------------------|-----------------------|--------------------------|
| DATE | STEP | Description of NC Section A | Corrective Action Section B | | | Verification Section C | Approval Chief Eng | Approval QC Inspector |
| | | | Initial Chief Eng | Action Description Chief Eng | Sign & Date | | | |
| | | | | | | | | |
| | | | | | | | | |
| | | | | | | | | |

NOTE: Date & initial all entries

Date: Thursday, 11/16/2006 4:22:00 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: SKID TUBE ASSEMBLY

Job Number: 29470

Part Number: D205634041

Job Number:



Seq. #:

Machine Or Operation:

Description :

19.0

AN960JD10L

Washer



Comment: Qty.: 44.0000 Each(s)/Unit Total : 44.0000 Each(s)

Pick:

| Qty | Part Number | Description | Batch |
|-----|-------------|-------------|---------|
| 4 4 | AN960JD10L | Washer | M102217 |

20.0

AN34A

Bolt



Comment: Qty.: 44.0000 Each(s)/Unit Total : 44.0000 Each(s)

Pick:

| Qty | Part Number | Description | Batch |
|-----|-------------|-------------|---------|
| 44 | AN3-4A | Bolt | M102832 |

21.0

D25941

Plug



Comment: Qty.: 16.0000 Each(s)/Unit Total : 16.0000 Each(s)

plug

Batch: B 2804

22.0

D25943

O-Ring



Comment: Qty.: 16.0000 Each(s)/Unit Total : 16.0000 Each(s)

o-ring

Batch: B 27168

23.0

D2855

Cap



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Cap

Batch: B 26351

24.0

AN35A

Bolt



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Bolt

Batch: M15205

a.m 06/12/14

| W/O: | | WORK ORDER CHANGES | | | | | | |
|------|------|--------------------|--|----|------|-----|-------------------------------------|--------------------------|
| DATE | STEP | PROCEDURE CHANGE | | By | Date | Qty | Approval Chief Eng / Prod Mgr | Approval QC Inspector |
| | | | | | | | | |
| | | | | | | | | |

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes ☒ No ☐ DQA: RP Date: 06/12/19
 QA: N/C Closed: _____ Date: _____

| NCR: | | WORK ORDER NON-CONFORMANCE (NCR) | | | | | | |
|------|------|----------------------------------|--------------------------------|---------------------------------|----------------|---------------------------|-----------------------|--------------------------|
| DATE | STEP | Description of NC Section A | Corrective Action Section B | | | Verification Section C | Approval Chief Eng | Approval QC Inspector |
| | | | Initial Chief Eng | Action Description Chief Eng | Sign & Date | | | |
| | | | | | | | | |
| | | | | | | | | |
| | | | | | | | | |

NOTE: Date & initial all entries

Date: Thursday, 11/16/2006 4:22:00 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: SKID TUBE ASSEMBLY

Job Number: 29470

Part Number: D205634041

Job Number:



Seq. #:

Machine Or Operation:

Description :

25.0

AN960JD10L

Washer



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Washer

Batch: M102217

a.m

06/12/14

①

26.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

1-Install inserts & wearplates as per Dwg. D2580. Use a drop of Sikaflex on insert holes before installing wearplates

A/R Sikaflex-291

Sikaflex expire date: 02/07

M102107

2-Coat D2594-3 O' rings with Petroleum Jelly and install on D2594-1 plugs as per Dwg D2580

3-Inspect for foreign object per QSI 024

4-Install 2855 Aft Cap as per Dwg D2580 and seal Fwd Step & Aft Cap with Sikaflex. Clean excess adhesive

A/R Sikaflex-291

Sikaflex expire date: 02/07

M102107

5-Wing Walk as per Dwg D2580 and QSI 005 4.4

M102635

m-R/a.m

Batch:

06/12/18

27.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: Inspect Aft Cap, Fwd Step and Wing Walk of work to Current Step Inspect for Foreign objects per QSI 024

28.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Identify and pack for shipping as per PPP D205-634-041

Location:

PPP Rev: E

03 06/12/19

29.0

QC21

FINAL INSPECTION/W/O RELEASE



Comment: FINAL INSPECTION/W/O RELEASE

06/12/19

| W/O: | | WORK ORDER CHANGES | | | | | | | |
|------|------|--------------------|--|----|------|-----|-------------------------------------|--------------------------|--|
| DATE | STEP | PROCEDURE CHANGE | | By | Date | Qty | Approval Chief Eng / Prod Mgr | Approval QC Inspector | |
| | | | | | | | | | |
| | | | | | | | | | |

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

| NCR: | | WORK ORDER NON-CONFORMANCE (NCR) | | | | | | |
|------|------|----------------------------------|--------------------------------|---------------------------------|----------------|---------------------------|-----------------------|--------------------------|
| DATE | STEP | Description of NC Section A | Corrective Action Section B | | | Verification Section C | Approval Chief Eng | Approval QC Inspector |
| | | | Initial Chief Eng | Action Description Chief Eng | Sign & Date | | | |
| | | | | | | | | |
| | | | | | | | | |
| | | | | | | | | |

NOTE: Date & initial all entries

| W/O: | | WORK ORDER CHANGES | | | | | | | |
|------|------|--------------------|--|----|------|-----|-------------------------------------|--------------------------|--|
| DATE | STEP | PROCEDURE CHANGE | | By | Date | Qty | Approval Chief Eng / Prod Mgr | Approval QC Inspector | |
| | | | | | | | | | |
| | | | | | | | | | |

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

| NCR: | | WORK ORDER NON-CONFORMANCE (NCR) | | | | | | |
|------|------|----------------------------------|--------------------------------|---------------------------------|----------------|---------------------------|-----------------------|--------------------------|
| DATE | STEP | Description of NC Section A | Corrective Action Section B | | | Verification Section C | Approval Chief Eng | Approval QC Inspector |
| | | | Initial Chief Eng | Action Description Chief Eng | Sign & Date | | | |
| | | | | | | | | |
| | | | | | | | | |
| | | | | | | | | |

NOTE: Date & initial all entries



| | | | |
|-------------------------------|--------------------------------|---|------------------------|
| DESIGN <i>[Signature]</i> | DRAWN BY <i>[Signature]</i> | DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA | |
| CHECKED <i>[Signature]</i> | APPROVED <i>[Signature]</i> | DRAWING NO. D2580 | REV. C SHEET 1 OF 2 |
| DATE 98.08.26 | | TITLE 205 SKIDTUBE ASSEMBLY SCALE NTS | |
| A | 96.09.16 | NEW ISSUE | |
| B | 96.12.02 | AS MANUFACTURED | |
| C | 98.08.26 | REDRAWN, INCLUDED DEO 9094/9097 | |

RELEASED
98/09/17 DS

| QTY | Part Number | Description |
|-----|---|-------------------|
| X | D2580-041 | SKIDTUBE ASSEMBLY |
| * | D2500-1 | EXTRUSION |
| 1 | D2596 | 205 WEB |
| 1 | D2575 | AFT CAP |
| 1 | D2576 - 3 | STEP |
| 20 | D2579 | CROSS BOLT SPACER |
| 16 | D2594-1 | PLUG |
| 16 | D2594-3 | O-RING |
| 1 | D2577-1 | WEARSHOE |
| 1 | D2577-3 | WEARSHOE |
| 1 | D2577-5 | WEARSHOE |
| 44 | ALS7-1032-130 or AKS7-1032-130 or AKS4-1032-130 or ALS4-1032-130 | INSERT |
| 46 | AN3-4A | BOLT |
| 46 | AN960JD10L | WASHER |


00 08.28
GP 00.08.23

EFFECTIVE DEOS
98/12/14
DEO 9124
DSD 9183


GENERAL NOTES:

- 1) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED
- 2) LENGTH OF D2500-1 EXTRUSION BEFORE BENDING = 190 INCHES *
- 3) INSERT D2596 WEB TO LOCATION SHOWN OFF AFT END OF SKIDTUBE AND BOND WEB INTO OUTER TUBE WITH NON-STRUCTURAL SIKAFLEX-241 ADHESIVE PER DART QSI 015 BEFORE BENDING. ENSURE HOLES LINE-UP.
- 4) BEND AS A SMOOTH RADIUS STARTING WITH A MAXIMUM CENTERLINE RADIUS OF 60 AND ENDING WITH A MINIMUM RADIUS OF 30. A MAXIMUM REDUCTION OF 0.200 IN DIAMETER IS ALLOWABLE IN THE BENT PORTION OF THE TUBE.
- 5) USE DART DRILL TEMPLATE TD2577-205 TO LOCATE AND DRILL $\varnothing 0.297$ HOLES FOR WEARSHOE INSERTS. INSTALL ALS7-1032-130 PER SECTION D-D (44 PLACES) AFTER FINISH. INSTALL AN3-4A BOLTS AND AN960JD10L WASHERS WITH SIKAFLEX-241.
- 6) WELDING TO BE DONE PER DART QSI 004.
- 7) FINISH:
ACID ETCH, ALODINE PER DART QSI 005 4.1 PRIOR TO INSERTING D2596 WEB
POWDER COAT ASSEMBLY GLOSS WHITE (REF 4.3.5.1) PER DART QSI 005 4.3
BLACK ANTI-SKID PAINT AS INDICATED PER DART QSI 005 4.4
- 8) INSERT D2594-1 PLUG C/W D2594-3 O-RING IN HOLES MARKED 'P' (BOTH SIDES OF TUBE) AFTER FINISH (16 PLACES).


SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
NOT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 29470

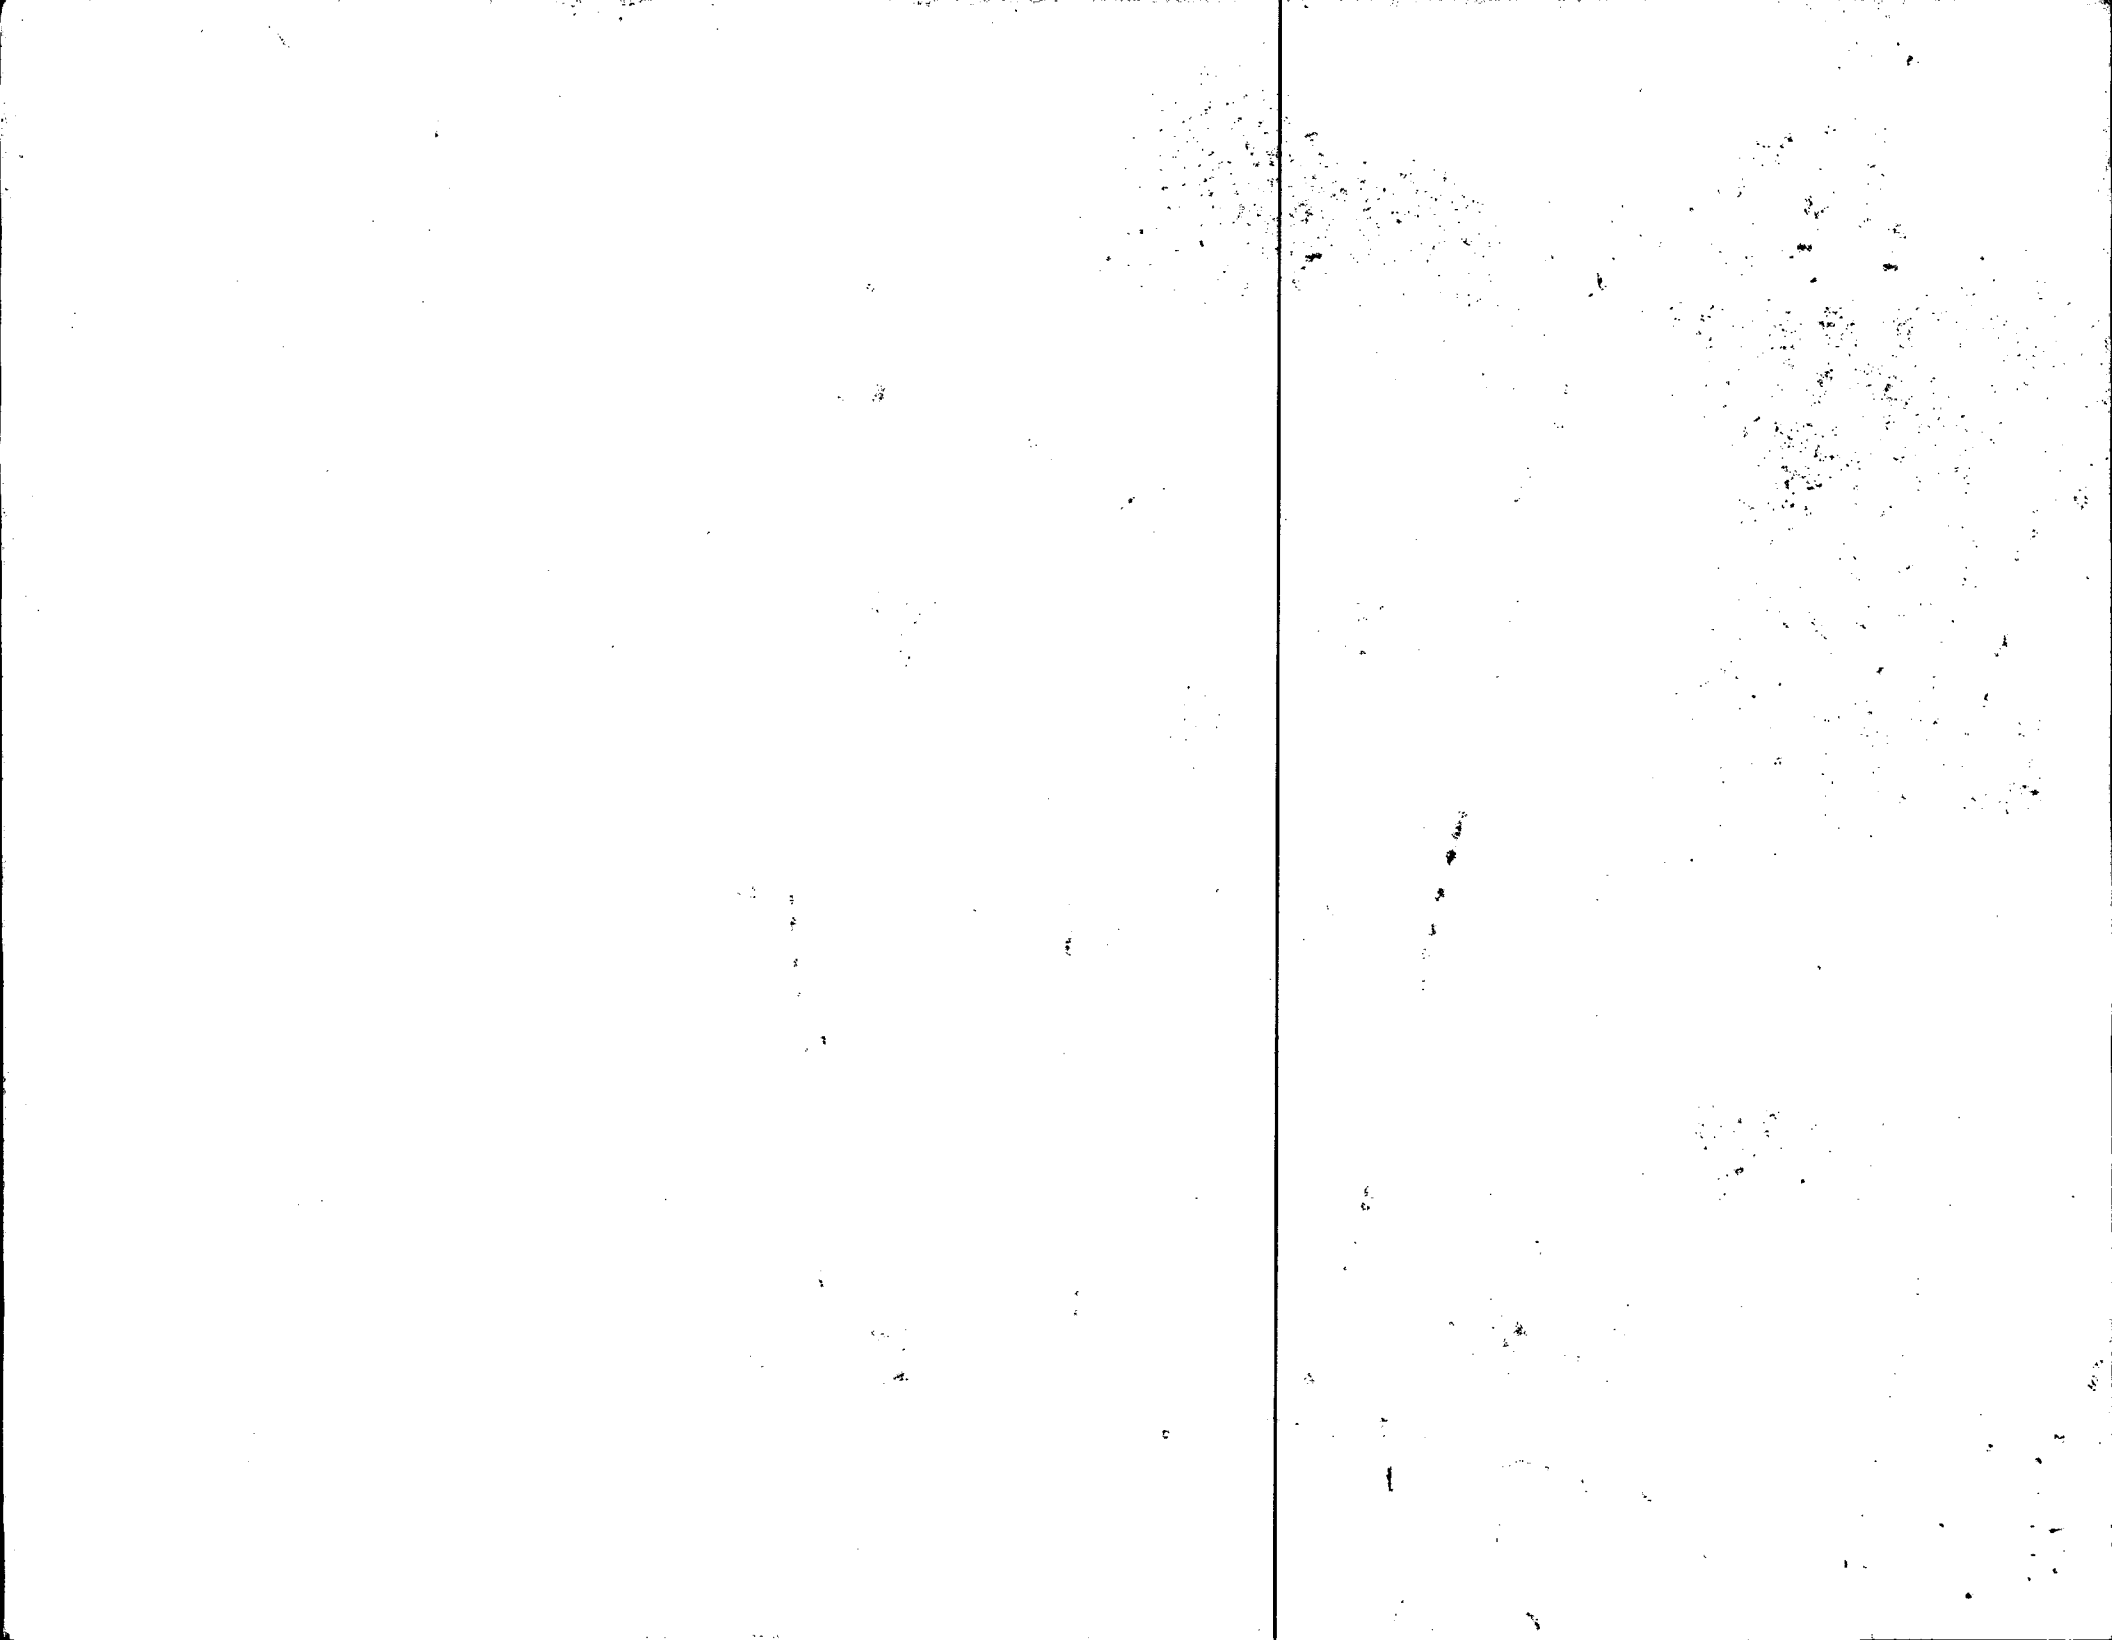


DETAIL A
SCALE 5:24

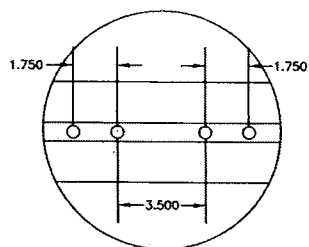


DETAIL B
SCALE 5:24

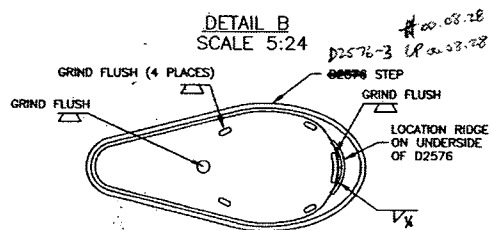

DETAIL C
SCALE 5:24

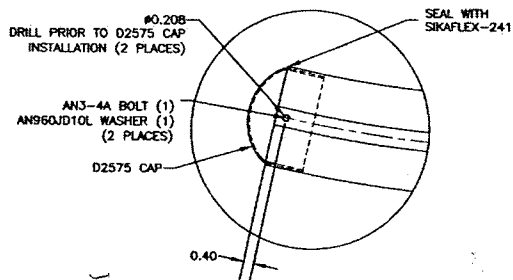


SECTION D-D
SCALE 5:24

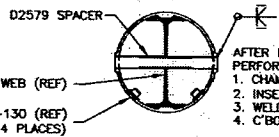


AFTER DRILLING AND BENDING ASSEMBLY
PERFORM THE FOLLOWING FOR #0.508 HOLES ONLY:
1. CHAMFER HOLE 0.050 X 45°
2. INSERT D2579 SPACER (20 PLACES)
3. WELD INTO PLACE AND GRIND FLUSH
4. C-BORE D2579 SPACER TO #0.437 X 1.00 DEEP


D2580-1 DRILLING DETAIL

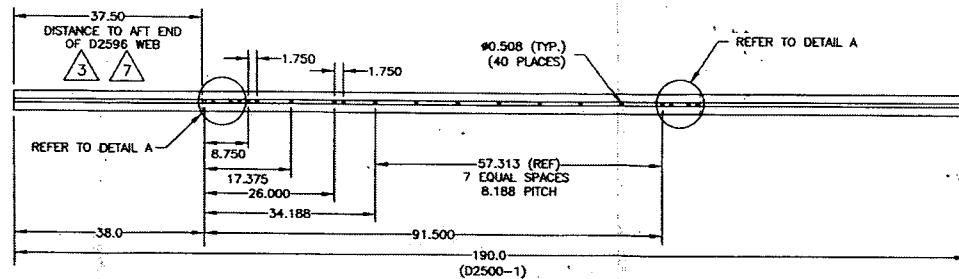

D2580-1 BENDING AND CUTTING DETAIL

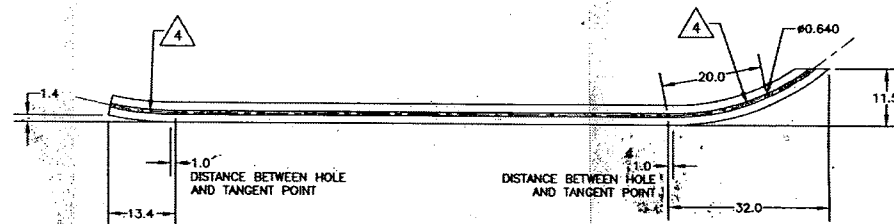


D2580-041 ASSEMBLY DETAIL

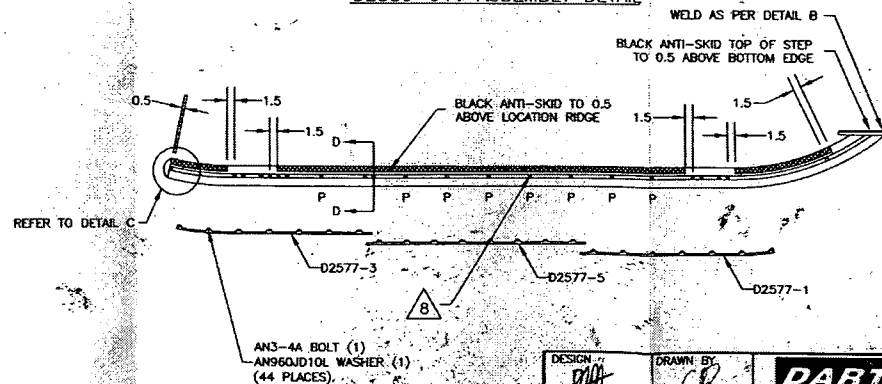

RELEASED
98/09/17 DS

| | | | |
|------------------|----------------|---|---------------|
| DESIGN D2580 | DRAWN BY CP | DART DART AEROSPACE LTD HARRISBURG, ONTARIO, CANADA | REV. C |
| CHECKED DAB | APPROVED CP | DRAWING NO. D2580 | SHEET 2 OF 2 |
| DATE 98.08.26 | | TITLE 205 SKIDTUBE ASSEMBLY | SCALE 1:24 |

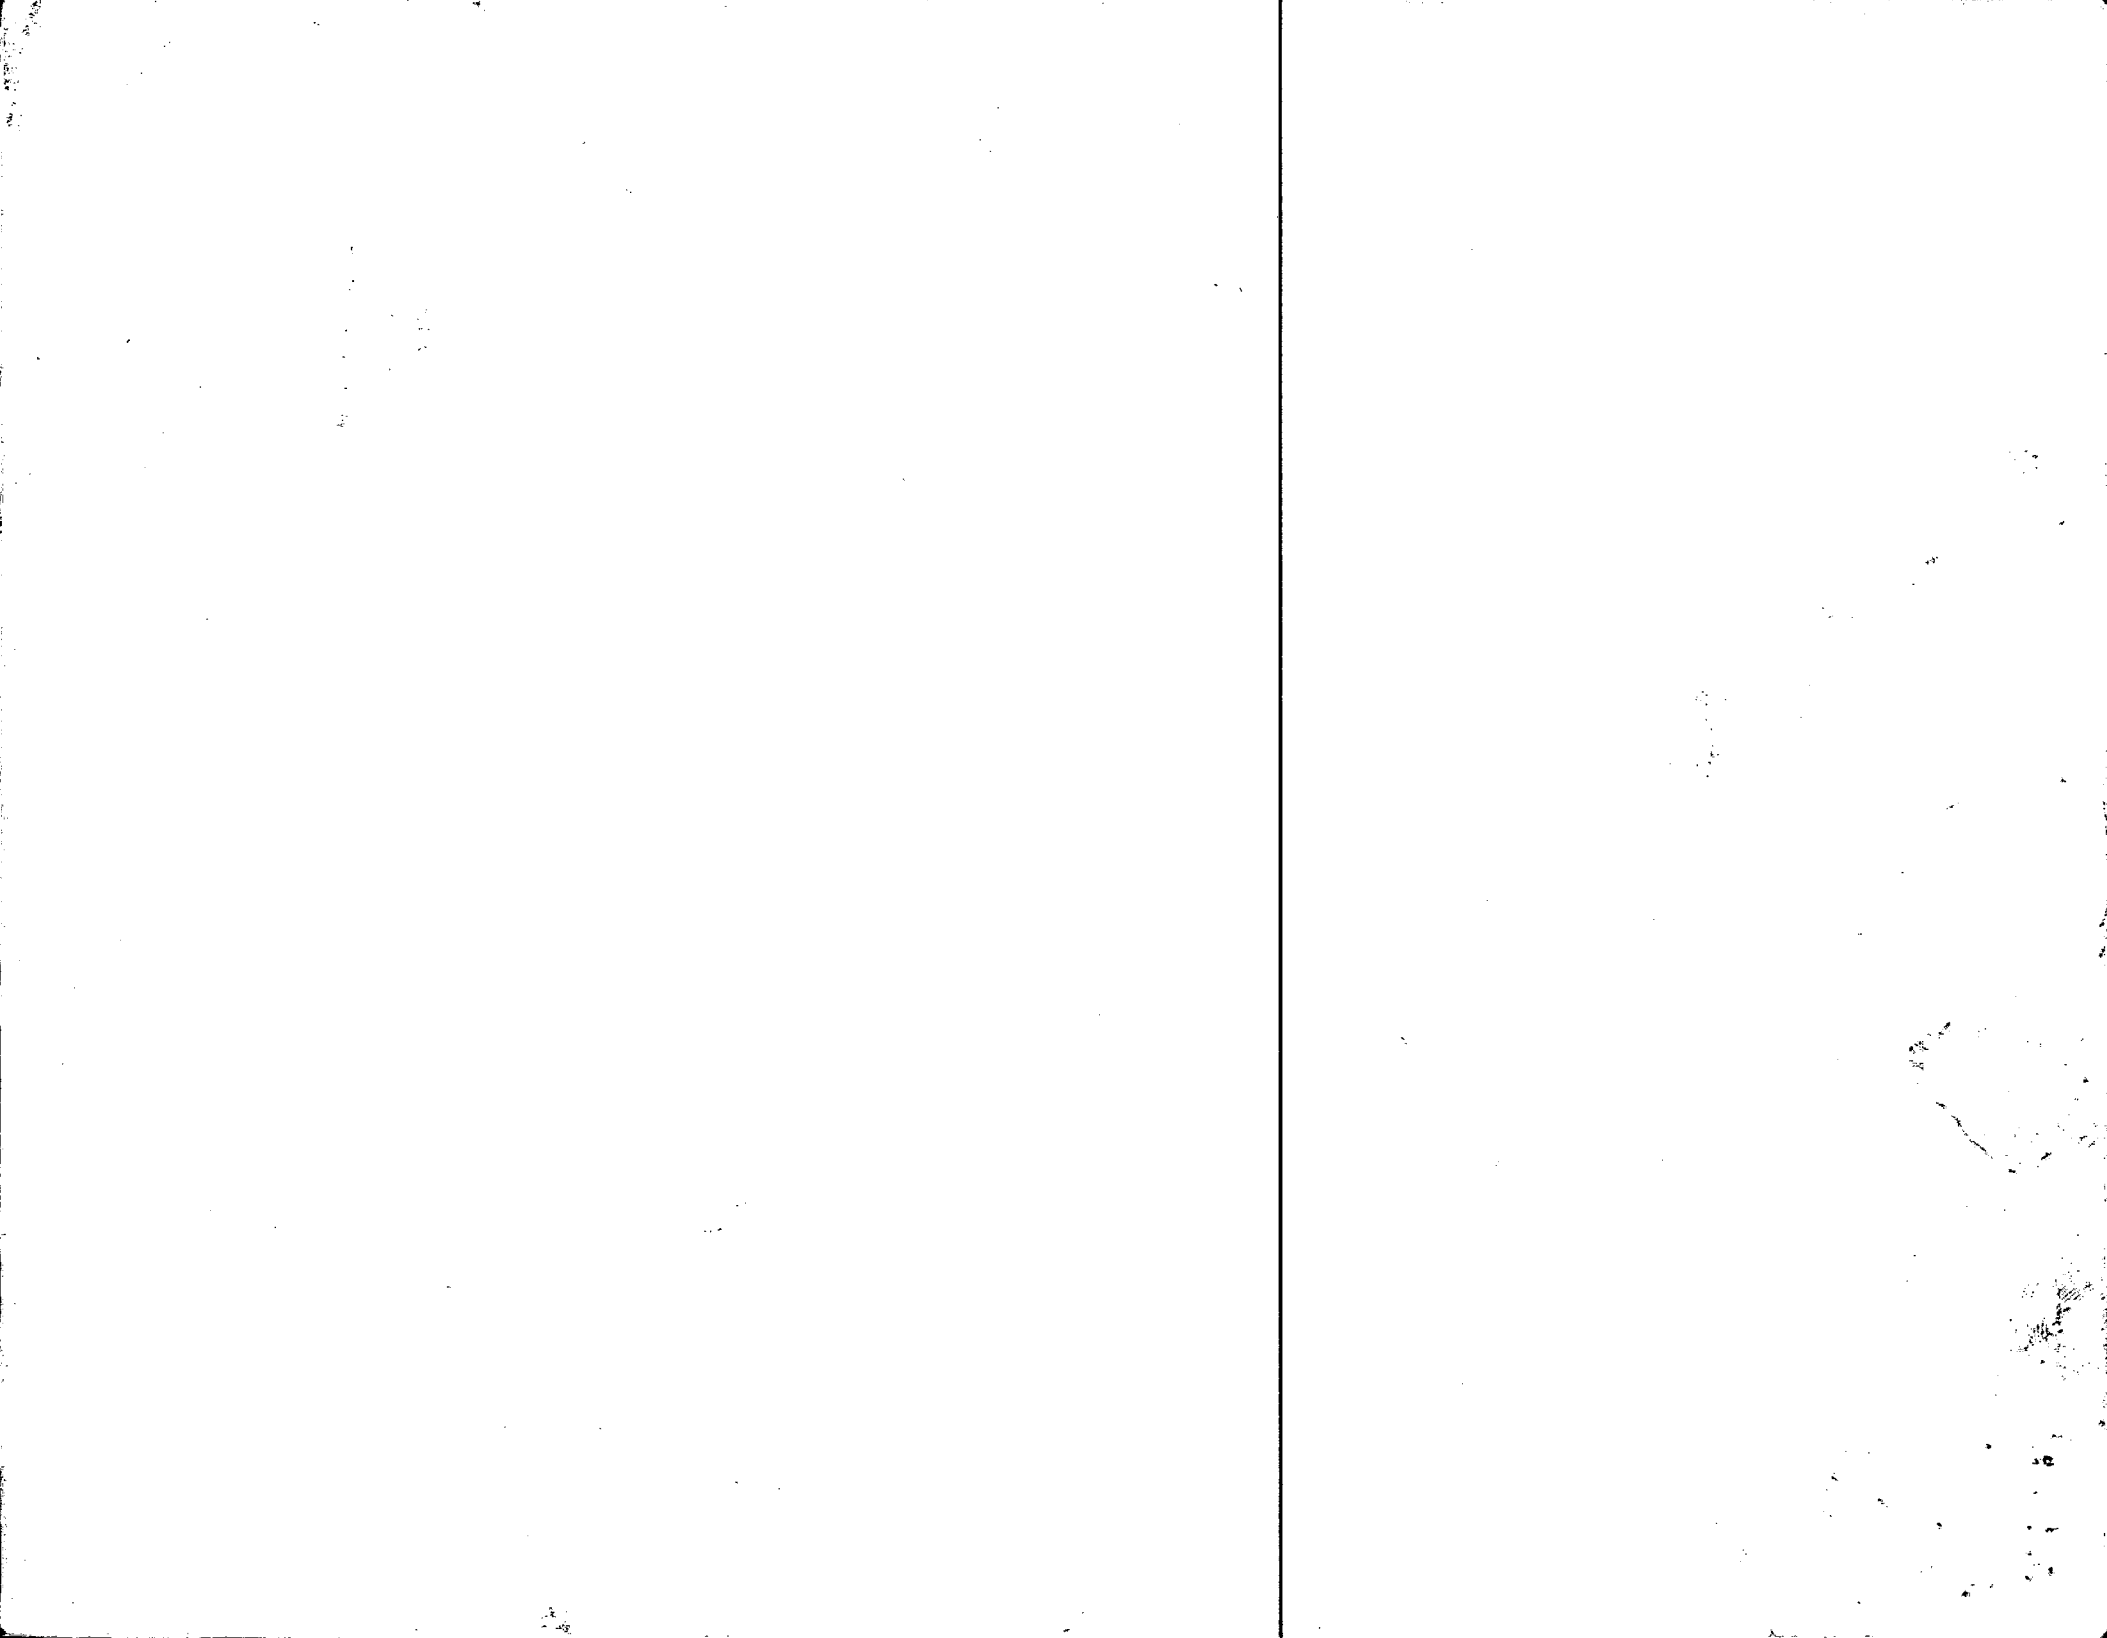

NO. 80

AWS D17.1.2001
QUALIFICATION TEST RECORD

Name Barclay Elliott
Joint Welding Procedure Tig
Part number and Job number A205 634 041 / B29469 A

TEST WELDS REQUIRED

BASE METAL Alum WELDING PROCESS Tig
Penetration Complete ☐ Partial ☒ Single Weld ☒ Double Weld ☐
Current AC ☒ DC ☐ Backing YES ☐ NO ☒

| | Position | Vertical | Down <input type="checkbox"/> | Up <input type="checkbox"/> |
|--------------|-----------------------------|-----------------------------|-------------------------------|-----------------------------|
| Sheet Groove | 1G <input type="checkbox"/> | 2G <input type="checkbox"/> | 3G <input type="checkbox"/> | 4G <input type="checkbox"/> |
| Tube Groove | 1G <input type="checkbox"/> | 2G <input type="checkbox"/> | 5G <input type="checkbox"/> | 6G <input type="checkbox"/> |
| Sheet Fillet | 1F <input type="checkbox"/> | 2F <input type="checkbox"/> | 3F <input type="checkbox"/> | 4F <input type="checkbox"/> |
| Tube Fillet | 1F <input type="checkbox"/> | 2F <input type="checkbox"/> | 4F <input type="checkbox"/> | 5F <input type="checkbox"/> |

Crossbolt Spacer Welded into Skidtube

TEST RESULTS

Visual Pass ☒ Fail ☐
Penetration Pass ☒ Fail ☐
Crossbolt Spacer Pass ☒ Fail ☐

The above named individual is qualified in accordance with AWS D17.1.2001 to weld

Date of Test Coupon 06/11/29 Qualifier David Muel

